


These are the Powerful and highly precise machines gives you much cost effective and versatile productivity at very economical cost.

Applications:

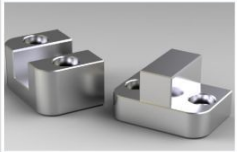

Specifications:

Model Type	Shusa PSM SP Series Machines		
	SP 8070	SP 6050	SP 5040
Working Table Size (mm)	700 x 900	600 x 600	580 x 400
X/Y/Z Axis Travel (mm)	700 x 800 x 320	650 x 500 x 200	500 x 400 x 200
X Y Z Accuracy (mm)	±0.01/300	±0.01/300	±0.01/300
X Y Z Repeatability (mm)	0.005	0.005	0.005
Flatness Error of Working Table (mm)	< 0.03	< 0.03	< 0.03
Media Height (mm)	50 - 350	50 - 300	30 - 240
Gantry Width (mm)	820	740	630
Max. Load Weight (Kg)	350	300	100
Pressure Deformation of Working Table	<0.02mm (300 Kg)	<0.02mm (300 Kg)	<0.02mm (100 Kg)
Spindle Power (KW)	5KW (Optional 4KW)	3KW (Optional 4KW)	2.2KW
Spindle Rotate Speed (RPM)	3000 - 18000	5000 - 24000	6000 - 24000
Max. Travel Speed (m/Min)	12	15	10
Total Power (KW)	13.5	7.5	4
Feed Motor	Panasonic Servo	Panasonic Servo	Panasonic Servo
Power Supply	380V ±10%, 50Hz	380V ±10%, 50Hz	220V ±10%, 50Hz
Net Weight (Kg)	4300	2800	2000
Gross Weight (Kg)	4500	2900	2100
Machine Size (mm)	1810 x 1900 x 2010	1720 x 1600 x 1930	1540 x 1530 x 1950
Optional	4th Axis, Manual quick cutter change, Auto cutter change	4th Axis, Manual quick cutter change, Auto cutter change	4th Axis, Manual quick cutter change, Auto cutter change



We are using LNC Controller



3D CNC Engraving Machine

...We're having



Machines in your service...